

Work Order ID 99468

April-09-13 11:38:36 AM

99468

Page 1

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 4/09/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/23/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 13-04-09 Tooling:

Date:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

Draw Nbr

Revision Nbr

D212-664-141

Rev D (DEO)

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA113

2-Turn first side as per Folio FA113

3-Blend transition lines only, **do not sand whole tube**.

FOLIO REV: AA

DWG REV: P

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

(Handwritten signature)
mm.l
13/04/25

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

(Handwritten signature)
mm.l
13/04/25

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | |
|---|------|------|---|---|-------------------|---|-------------|--------------|---|--|--|
| Work Order: _____ Part No. _____ NCR No. _____ | | | | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | | AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div> | | | | | |
| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector | | |
| Doc/Data <input type="checkbox"/> | | | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | | | |
| FAULT CATEGORY | | | | | | | | | | | |
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | | | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | | | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions | | | <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other | | |

Work Order ID 99468

April-09-13 11:38:36 AM

99468

Page 2

Item ID: D212-664-101TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 4/09/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/23/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA113

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: 77DWG REV: 77

3-Remove sand and plugs

1 0mmil
13/04/20

130

0.00

130

QC1- Inspect dimensions to dimension sheet

QC

Memo

0.00

Quality Control

+ PERFORM ULTRA SONIC MEASUREMENT

1 0mmil
13/04/20

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabelled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Work Order ID 99468

April-09-13 11:38:36 AM

99468

Page 3

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 4/09/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/23/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

140 QC8- Inspect parts - second check

0.00

140

QC

Quality Control

Memo

0.00

+ CHECK ULTRA SONIC MEASUREMENT AND ORIENTATION FOR BENDING

TW 13-05-09

145

0.00

145

Crosstubes

Crosstubes

Memo

0.00

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

KC 13-05-14

150

0.00

150

HandFXtube

Hand Finishing Crosstubes

Memo

0.00

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

1 Ø
SM 21-L 13/05/09

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions |
|---|---|---|

| | |
|--|---|
| <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge | <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|--|---|

Work Order ID 99468

April-09-13 11:38:36 AM

99468

Page 4

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 4/09/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/23/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|---|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
| 160 | QC5- Inspect part completeness to step on W/O | 0.00 | | | | | | | |
| *160* | | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | |
| Quality Control | | | | | | | | | |
| 170 | | 0.00 | | | | | | | |
| *170* | Packaging | | | | | | | | |
| Packaging | Memo | 0.00 | | | | | | | |
| Packaging | Identify and Stock in kanban rack | | | | | | | | |
| | Location: <u>LG</u> | | | | | | | | |
| 180 | QC21- Final Inspection - Work Order Release | 0.00 | | | | | | | |
| *180* | | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | |
| Quality Control | | | | | | | | | |

MD 13/05/22

MLJ 13-05-23

MF 13-5-22

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|---|------------------------------------|--|---|---|--------------------------|--|------------------------|---------------------|---|--|--|------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | | | | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | | AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube <input type="checkbox"/></td> <td style="width:15%;">Crosstube <input type="checkbox"/></td> <td style="width:15%;">Water Jet <input type="checkbox"/></td> <td style="width:15%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | | | | | | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | |
| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector | | | | | | | | | | | | | | | | | | |
| Doc/Data <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| FAULT CATEGORY | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | | | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | | | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions | | | <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other | | | | | | | | | | | | | | | | | | |

Picklist Print

April-09-13 11:38:40 AM

Page 1

Work Order ID: 99468

99468

Parent Item: D212-664-101TRN

D212-664-101TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 4/09/13

Required Date: 4/23/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 removed Polish EC verified by: DD

| Component Item ID/ Item Name | Replacement Item ID | Mfg/ Purch | Bin Item | Primary Location | Last Location | Route Seq ID | Unit of Measure | Qty on Hand | Qty per Kit | Total Qty | Qty Issued | Date Issued | Status |
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|
| D6005-128 | | Manufactured | No | | | 120 | Each | 44.0000 | 1 | 1 | | | |

D6005-128

Crosstube Material

**

Location

Loc Qty

Loc Code

LG

36

75631

36

LG015

8

75628

8

1

KE 13-4-24

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions |
| <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge | | |
| <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other | | |


| | | | |
|---|--|---------------------|--------------|
| DART AEROSPACE LTD | | Work Order: | 99468 |
| Description: Crosstube Assembly (205/212/412 High Fwd) | | Part Number: | D212-664-141 |
| Inspection Dwg: D212-664-141 Rev: D | | Page 1 of 2 | |

FIRST ARTICLE INSPECTION CHECKLIST

| | Inspection Sheet Drawing Dimension | Tolerance | Actual Dimension | Accept | Reject | Method of Inspection | Comments |
|--------|---------------------------------------|---------------|---------------------|--------|--------|-------------------------|----------|
| SIDE A | 0.200 | +/-0.010 | 2.200 | / | | vern | CNC-08 |
| | R0.063 | +/-0.010 | 0.063 | / | | RG | |
| | 2.740 | +0.005/-0.000 | 2.740 | / | | vern | CNC-08 |
| | 5.097 | +/-0.030 | 5.100 | / | | | |
| | 2.304 | +0.005/-0.000 | 2.308 | / | | | |
| | 2.340 | +0.005/-0.000 | 2.344 | / | | | |
| | 2.398 | +0.005/-0.000 | 2.403 | / | | | |
| | 2.448 | +0.005/-0.000 | 2.453 | / | | | |
| | 2.498 | +0.005/-0.000 | 2.502 | / | | | |
| | 2.549 | +0.005/-0.000 | 2.553 | / | | | |
| | 2.599 | +0.005/-0.000 | 2.602 | / | | | |
| | 2.671 | +0.005/-0.000 | 2.673 | / | | | |
| | 2.701 | +0.005/-0.000 | 2.702 | / | | | |
| SIDE B | 0.200 | +/-0.010 | 2.200 | / | | vern | CNC-08 |
| | R0.063 | +/-0.010 | 0.063 | / | | RG | |
| | 2.740 | +0.005/-0.000 | 2.741 | / | | vern | CNC-08 |
| | 5.097 | +/-0.030 | 5.100 | / | | | |
| | 2.304 | +0.005/-0.000 | 2.308 | / | | | |
| | 2.340 | +0.005/-0.000 | 2.344 | / | | | |
| | 2.398 | +0.005/-0.000 | 2.403 | / | | | |
| | 2.448 | +0.005/-0.000 | 2.453 | / | | | |
| | 2.498 | +0.005/-0.000 | 2.502 | / | | | |
| | 2.549 | +0.005/-0.000 | 2.553 | / | | | |
| | 2.599 | +0.005/-0.000 | 2.602 | / | | | |
| | 2.671 | +0.005/-0.000 | 2.674 | / | | | |
| | 2.701 | +0.005/-0.000 | 2.702 | / | | | |
| | 126.514 | +/-0.020 | 126.534 | / | | type | ERB-11 |

| | | | |
|---|--|---------------------|--------------|
| DART AEROSPACE LTD | | Work Order: | 99468 |
| Description: Crosstube Assembly (205/212/412 High Fwd) | | Part Number: | D212-664-141 |
| Inspection Dwg: D212-664-141 Rev: D | | Page 2 of 2 | |

WALL THICKNESS MEASUREMENT

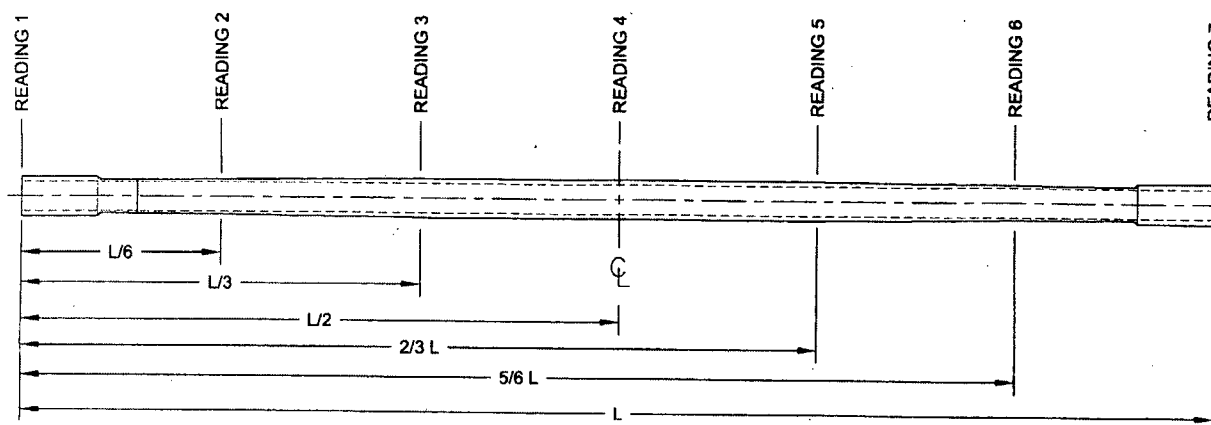

| Location | WALL THICKNESS MEASUREMENT (IN) | | | | Deviation Δw (max-min) | TOLERANCE |
|-------------------------|---------------------------------|------|------|------|--------------------------------------|-----------|
| | w1 | w2 | w3 | w4 | | |
| READING 1 L= 0" | .394 | .387 | .371 | .384 | .023 | 0.048" |
| READING 2 L= 21.085 | .244 | .244 | .249 | .249 | .005 | |
| READING 3 L= 42.171 | .361 | .362 | .356 | .357 | .006 | |
| READING 4 L= 63.257 | .389 | .390 | .379 | .380 | .011 | |
| READING 5 L= 84.342 | .365 | .359 | .351 | .359 | .014 | |
| READING 6 L= 105.47 | .252 | .252 | .241 | .238 | .011 | |
| READING 7 L= 126.514 | .395 | .387 | .371 | .377 | .024 | |

Calibration Result

Actual Block Thickness: 100-500

SITESCAN 250 Measured Thickness: 100-500

| | | |
|------------------------|-----------------------|-----------------------|
| Measured by: <u>KC</u> | Audited by: <u>TW</u> | Preliminary Approval: |
| Date: <u>13-4-28</u> | Date: <u>13-05-09</u> | Date: |

| Rev | Date | Change | Revised by | Approved |
|-----|----------|--|------------|--------------------|
| A | 05.04.27 | New Issue (P/O D412-664-101) | KJ/JLM | |
| B | 06.03.15 | Tolerance revised for 5.097 per Dwg Rev update | KJ/JLM | |
| C | 07.05.28 | Dwg Rev updated | KJ/JLM | |
| D | 10.02.02 | Dimension 126.514 was 126.51 | KJ | |
| E | 12.06.04 | Wall thickness form added | KJ | <u>[Signature]</u> |

| Item | Qty -141 | Qty -141B | Part Number | Description |
|------|-------------|--------------|----------------|---|
| 1 | X | | D212-664-141 | CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) |
| 2 | | X | D212-664-141B | CROSSTUBE ASSEMBLY (214 HIGH FWD) |
| 3 | 1 | 1 | D6005-128 | CROSSTUBE |
| 4 | 2 | 2 | D2893-1 | SUPPORT |
| 5 | 4 | 4 | D3595-063-450 | RUBBER CUSHION |
| 6 | 4 | 4 | MS21920-25 | CLAMP (OR MS21920-26) |
| 7 | A/R | A/R | MAGNOBOND 6398 | ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE) |

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS
- WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SH
UNCONT
SUBJECT

NO 99468 MLC

13-04-09

REMOVED FROM UNDER REVIEW 982
UNDER REVIEW 80411-614
11/10/13
FOR PRO-SEALING SUPPORT 2.11.07.26

DEO ATTACHED

RELEASED
2009-10-29

| | | | |
|------------|--|--|--------------|
| D | REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4 | RF | 09.09.30 |
| C | REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS | PH | 07.03.08 |
| B | ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIOTUBES | PH | 05.02.04 |
| A | NEW ISSUE | PH | 00.12.12 |
| REV. | DESCRIPTION | BY | DATE |
| DESIGN | PH | DART AEROSPACE LTD | |
| DRAWN | RF | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | PH | DRAWING NO. | REV. D |
| MFG. APPR. | PH | D212-664-141 | SHEET 1 OF 4 |
| APPROVED | PH | TITLE | SCALE |
| DE APPR. | PH | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 09.09.30 | COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

99468

12 13 15
D2893-1 SUPPORT
MS21920-25 CLAMP, 2X
D3595-063-450 RUBBER CUSHION, 2X
2 PL

A4-2

A

14.00 (-141)
OR 13.75 (-141B)

D

D212-664-501
BENT TUBE

SYM


D212-664-141/-141B
ASSEMBLY DETAIL

D

UNDER REVIEW

DEO ATTACHED


RELEASED
2009-10-29

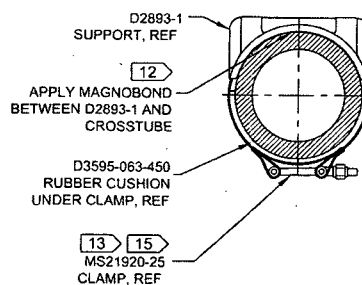

SECTION A-A D5-2
SCALE 4X

| | | | |
|--|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE LTD | |
| DRAWN | RF | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | 97 | DRAWING NO. | REV. D |
| MFG. APPR. | 11 | D212-664-141 | SHEET 2 OF 4 |
| APPROVED | 14 | TITLE | SCALE |
| DE APPR. | 14 | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 09.09.30 | COPYRIGHT © 2000 BY DART AEROSPACE LTD | |
| THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | | | |


99468

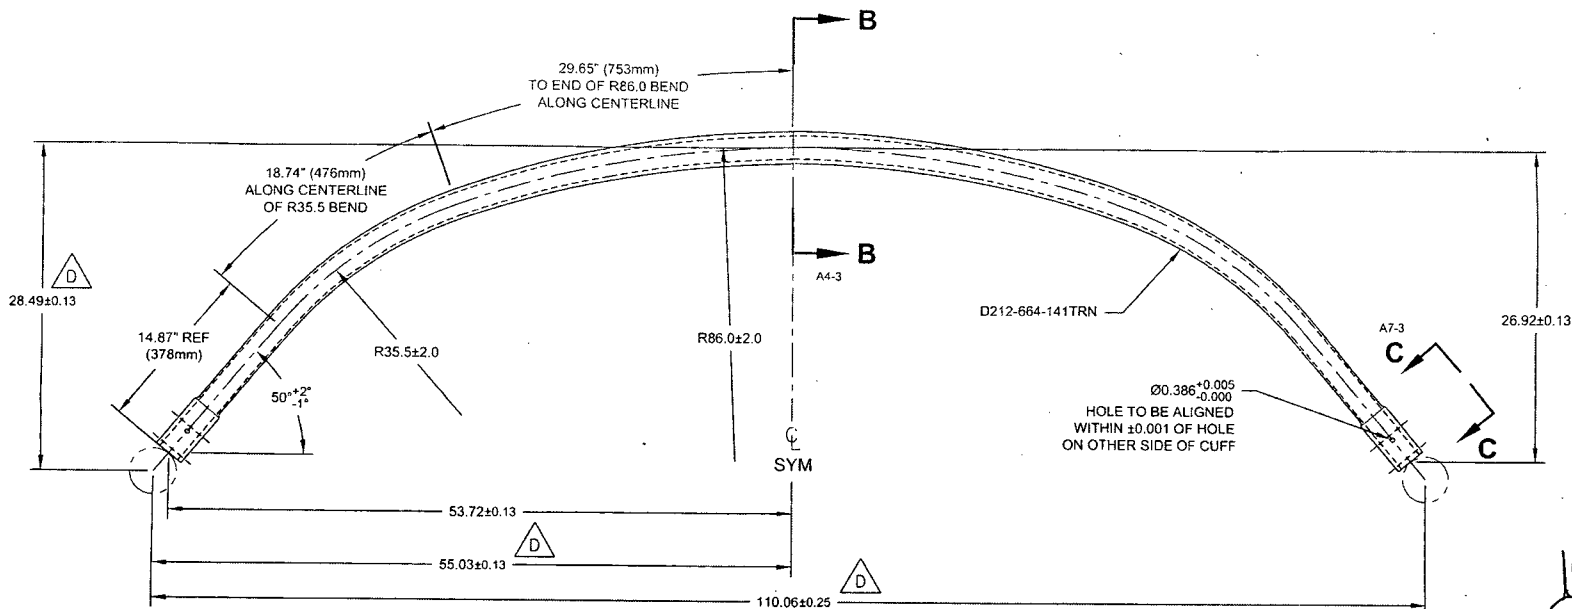


D212-664-501
BENDING AND DRILLING DETAIL



DO NOT SCALE
11.09.03
UNDER REVIEW

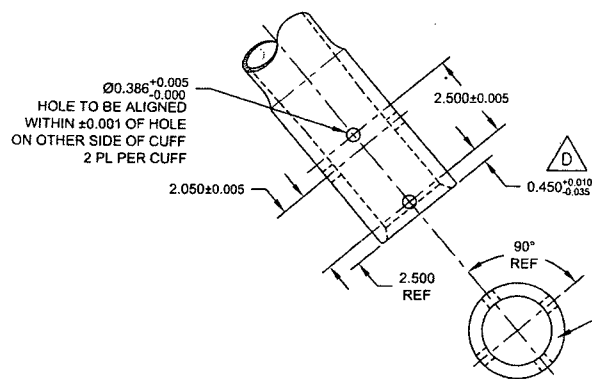

VIEW C-C: CUFF DETAIL
SCALE 3X

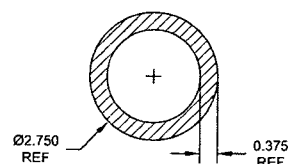



SECTION B-B
SCALE 4X

DEO ATTACHED


RELEASED
2009-10-29

| | | | |
|--|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE LTD | |
| DRAWN | RF | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | 90 | DRAWING NO. | REV. D |
| MFG. APPR. | 18 | D212-664-141 | SHEET 3 OF 4 |
| APPROVED | 10 | TITLE | SCALE |
| DE APPR. | 11 | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 09.09.30 | COPYRIGHT © 2000 BY DART AEROSPACE LTD | |
| THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | | | |


99468

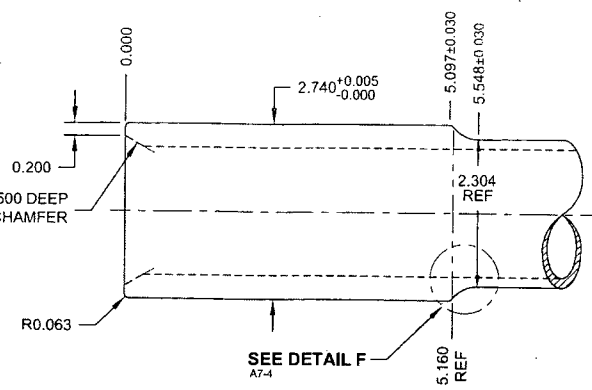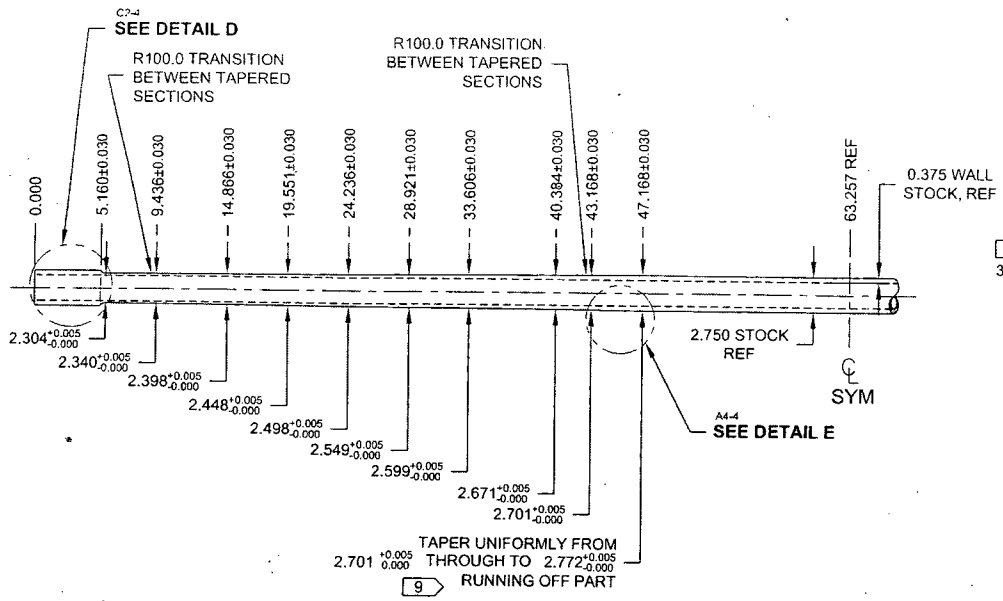

DETAIL D:
CROSSTUBE CUFF D8-4
SCALE 5X

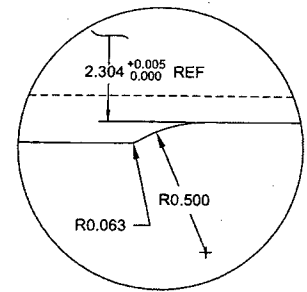

DETAIL F:
CUFF TRANSITION C2-4
SCALE 10X

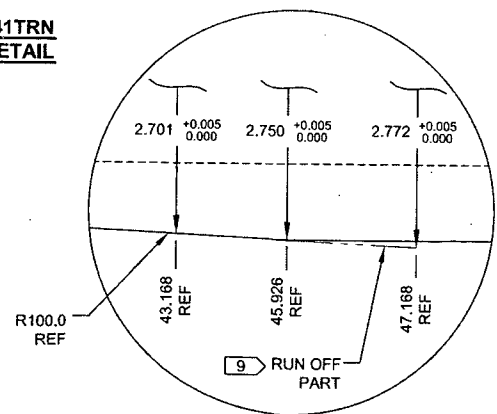

DETAIL E:
TAPER RUN-OFF C5-4
NOT TO SCALE

UNDER REVIEW
11.06.13

DEO ATTACHED

RELEASED
2009-10-29
AWP

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| DRAWN | RF | | |
| CHECKED | 9 | DRAWING NO. | REV. D |
| MFG. APPR. | 13 | D212-664-141 | SHEET 4 OF 4 |
| APPROVED | 12 | TITLE | SCALE |
| DE APPR. | 14 | XTUBE ASS'Y (205/212/412 HI FWD) | NTS |
| DATE | 09.09.30 | COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

99468

| | | | | | | | |
|-----------------------------|--|------------|---|----------|--------------------------------|---------------------------|--------------|
| DRAWING NO. D212-664-141 | TITLE XTUBE ASSY (205/212/412 HI FWD) | REV. D | DART AEROSPACE LTD ENGINEERING ORDER | | D.E.O. NO. D212-664-141-D-1 | SHEET NO. SHEET 1 OF 2 | SCALE NTS |
| DRAWN | CHECKED | MFG. APPR. | APPROVED | DE APPR. | DATE | DATE | DATE |
| 11.04.07 | 11.04.11 | 11.04.12 | 11/04/12 | 11.04.12 | 11.04.12 | 11.04.12 | 11.04.12 |

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

14/06.13
12/05.11-614
12/11.09.28

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

99468

| | | | | | | |
|-----------------------------|--|---------------------|---|--------------------------------|---------------------------|--------------|
| DRAWING NO. D212-664-141 | TITLE XTUBE ASSY (205/212/412 HI FWD) | REV. D | DART AEROSPACE LTD ENGINEERING ORDER | D.E.O. NO. D212-664-141-D-1 | SHEET NO. SHEET 2 OF 2 | SCALE NTS |
| DRAWN | CHECKED <i>UP</i> | MFG. APPR. <i>E</i> | APPROVED <i>WAD</i> | DE APPR. <i>WAD</i> | | |
| DATE 11.04.07 | DATE 11.04.11 | DATE 11.04.12 | DATE 11/04/12 | DATE 11.04.12 | | |

IS:

WAS:


UNDER REVIEW

UP 11/06/13

ECN# 11-614


11.07.28

D212-664-501
BENT TUBE

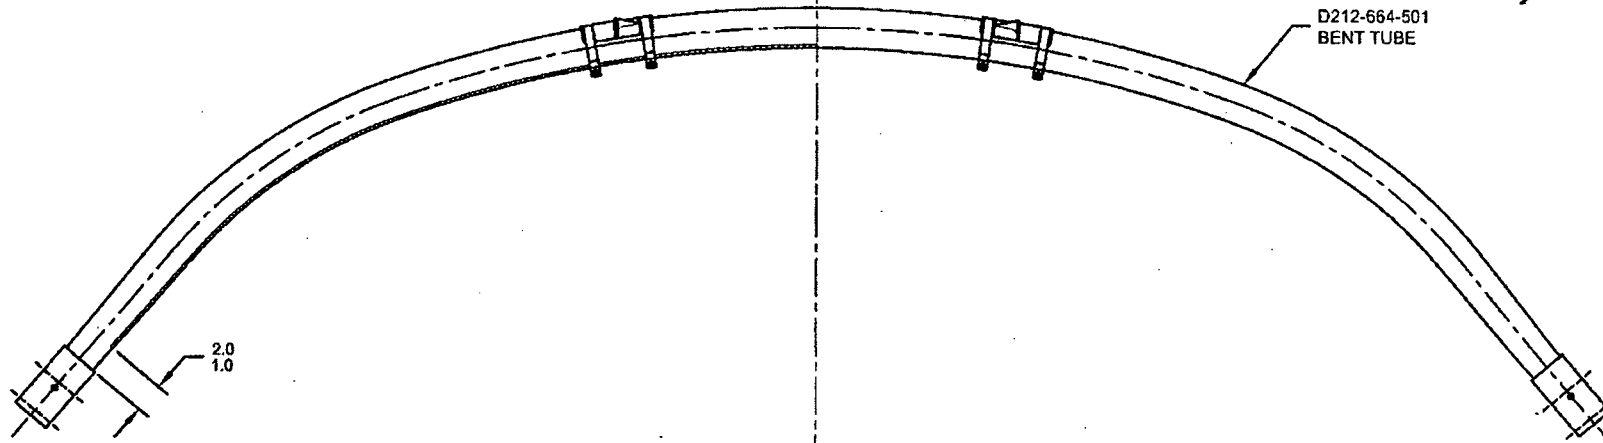

**D212-664-141/-141B
ASSEMBLY DETAIL**

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

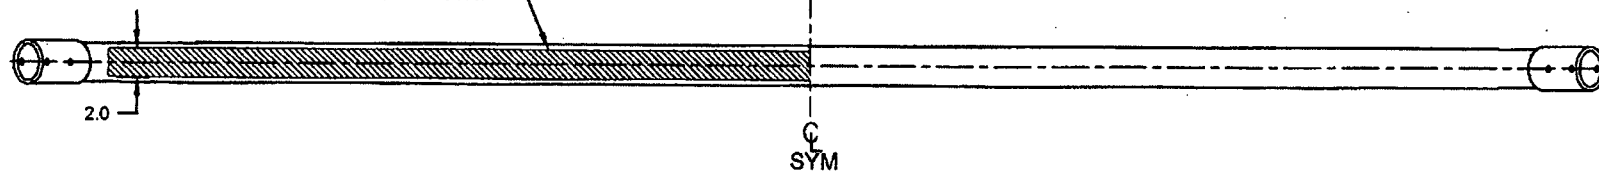

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

99468

| | | | | | | | |
|-----------------------------|---------------------------------------|-------------------------|---|--|--------------------------------|---------------------------|--------------|
| DRAWING NO. D212-664-141 | TITLE CROSSTUBE ASS'Y (205 HI FWD) | REV. D | DART AEROSPACE LTD ENGINEERING ORDER | | D.E.O. NO. D212-664-141-D-2 | SHEET NO. SHEET 1 OF 1 | SCALE NTS |
| DRAWN <i>UP</i> | CHECKED <i>ASS</i> | MFG. APPR. <i>AS</i> | APPROVED <i>MP</i> | | DE APPR. <i>TH</i> | | |
| DATE 11.07.15 | DATE 11.07.20 | DATE 11.07.21 | DATE 11/07/21 | | DATE 11.07.21 | | |

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

| Item | Qty -141 | Qty -141B | Part Number | Description |
|------|-------------|--------------|-----------------|-------------------------------|
| 7 | A/R | A/R | PROSEAL 890 B-2 | SEALANT, AMS-S-8802 CLASS B-2 |

WAS:

| | | | | |
|---|-----|-----|----------------|---|
| 7 | A/R | A/R | MAGNOBOND 6398 | ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE) |
|---|-----|-----|----------------|---|

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
W

99468

| | | | | | | | | | | | |
|-----------------------------|--|--|--|---|--|--------------------------------|--|---------------------------|--|--------------|--|
| DRAWING NO. D212-664-141 | | TITLE XTUBE ASSY (205/212/412 HI FWD) | | REV. D DART AEROSPACE LTD ENGINEERING ORDER | | D.E.O. NO. D212-664-141-D-3 | | SHEET NO. SHEET 1 OF 1 | | SCALE NTS | |
| DRAWN AJS | | CHECKED JP | | MFG. APPR. 140 | | APPROVED 140 | | DE APPR. 140 | | | |
| DATE 12.06.28 | | DATE 12.07.05 | | DATE 12.07.05 | | DATE 12.07.05 | | DATE 12.07.05 | | | |

PURPOSE:

ADD NEW CONFIGURATION WITH ANODIZED FINISH

ADD -141F CONFIGURATION TO PARTS LIST AS SHOWN BELOW:

| Item | Qty -141 | Qty -141B | Qty -141F | Part Number | Description |
|------|-------------|--------------|--------------|-----------------|--|
| 1 | X | | | D212-664-141 | CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) |
| 2 | | X | | D212-664-141B | CROSSTUBE ASSEMBLY (214 HIGH FWD) |
| | | | X | D212-664-141F | CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED) |
| 3 | 1 | 1 | 1 | D6005-128 | CROSSTUBE |
| 4 | 2 | 2 | 2 | D2893-1 | SUPPORT |
| 5 | 4 | 4 | 4 | D3595-063-450 | RUBBER CUSHION |
| 6 | 4 | 4 | 4 | MS21920-25 | CLAMP (OR MS21920-26) |
| 7 | A/R | A/R | A/R | PROSEAL 890 B-2 | SEALANT, AMS-S-8802 CLASS B-2 |

*NOTE ITEM 7 HAS BEEN UPDATED IN ACCORDANCE WITH DEO D212-664-141-D-2

AMEND NOTE 2 AS FOLLOWS:

IS:

- 2) FINISH -141 & -141B ONLY: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT

- FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT

***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN
NOT TO CONTAMINATE OR DAMAGE FINISHED SURACES.

WAS: (UPDATED PER DEO D212-664-141-D-1)

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

RELEASED
2012-07-10
JP

